

Service Information



NAKAMICHI

Model LX-5
Serial No. _____
Subject Meter Problem

No. NR-0042
Date 3/1/82

When a deck is returned to your service station for the meter problem with all the LED segments lit up, the meter IC may have been broken. When you find it to be the cause, it is suggested that you apply the following modification as you replace the meter IC.

1. Remove the Top Cover.
2. Remove the Front Panel Ass'y.
3. Remove the Meter Ass'y.
4. Take the Meter P.C.B. Ass'y out of the shield case of the Meter Ass'y.
5. Add the ceramic capacitor (330 pF) between Pin 10 of the Meter IC (IC 901) and ground (Pin 12) on the dip side of the Meter P.C.B. Ass'y.
6. Add the ceramic capacitor (330 pF) between Pin 11 of the Meter IC (IC 901) and ground (Pin 12) on the dip side of the Meter P.C.B. Ass'y.
*If the meter IC is already broken, replace the IC before adding the capacitors.
7. Put everything back together and make sure the unit works properly.